

CAUTION : Read instructions thoroughly and completely prior to beginning installation.




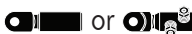

 





 

Installation instructions for separable tee connector - type C interface



**(K),(M),(P)484TB/G**  
Up to 41,5 kV

Only to be used on copper wire screened cable with extruded easy strip or bonded semi-conductive screen and stranded circular conductors of copper or aluminium.


**Required components for the connector installation :**

 <p>3 x 484TB/G tee connector</p>	 <p>3 x Cable reducer 611CA-W</p>	 <p>3 x Clamping screw - 430TCS</p>	 or  +  <p>3 x Conductor contact - TBC-X or TMBC-X + Installation instructions</p>	
 <p>3 x Basic insulating plug + cap - 800BIPA</p>	 <p>Field control mastic, type MFC-RLT</p>	 <p>Water sealing mastic, type MWS (outdoor applications)</p>	 <p>Silicone grease + wipers</p>	 <p>Gloves</p>
 <p>Roll adhesive tape</p>	 <p>Installation instructions</p>			


FOR INFORMATION ONLY Please always use the instructions supplied in the kit

**NB : Only one phase is shown in these instructions. Make off all three phases the same way. Use a cable conversion kit for 3-core cables.**

## CABLE PREPARATION

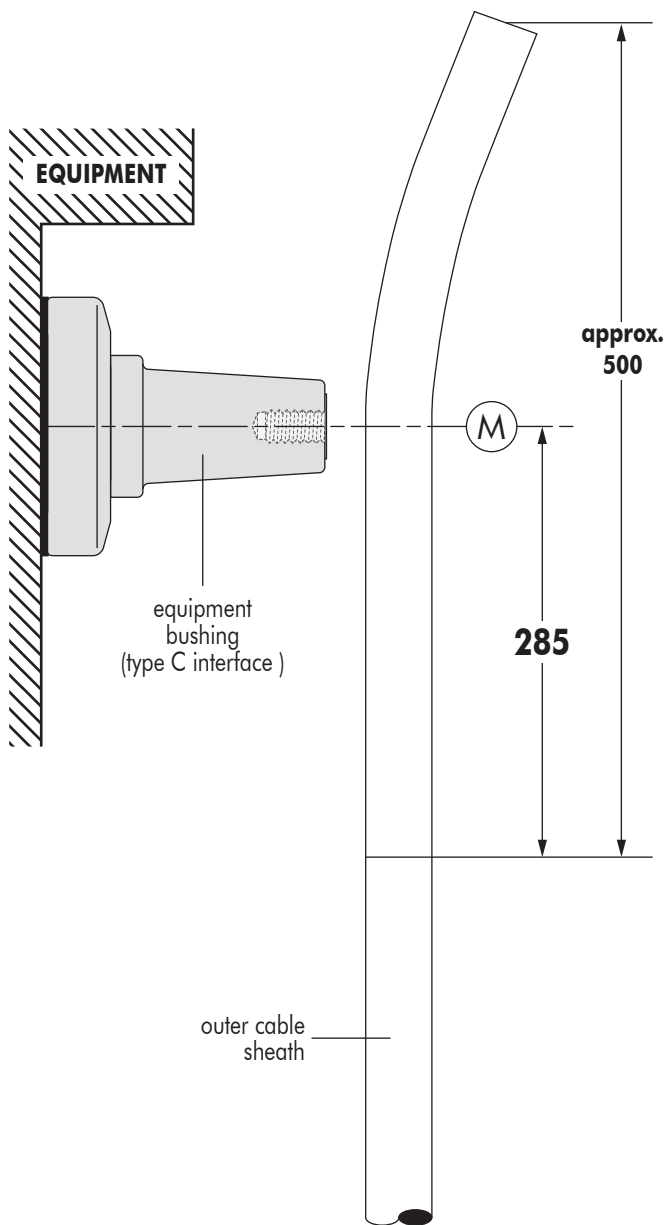

- 1 Train the cable into the approximate finished position next to the equipment bushing.
- 2 Mark the centre line « M » of the bushing.
- 3 Remove the outer cable sheath to a point 285 mm from the centre line « M » of the bushing.
- 4 Apply a tape marker around the outer sheath 65 mm from the edge. For indoor applications, bend the screen wires back over the outer sheath and proceed to step no. 5.

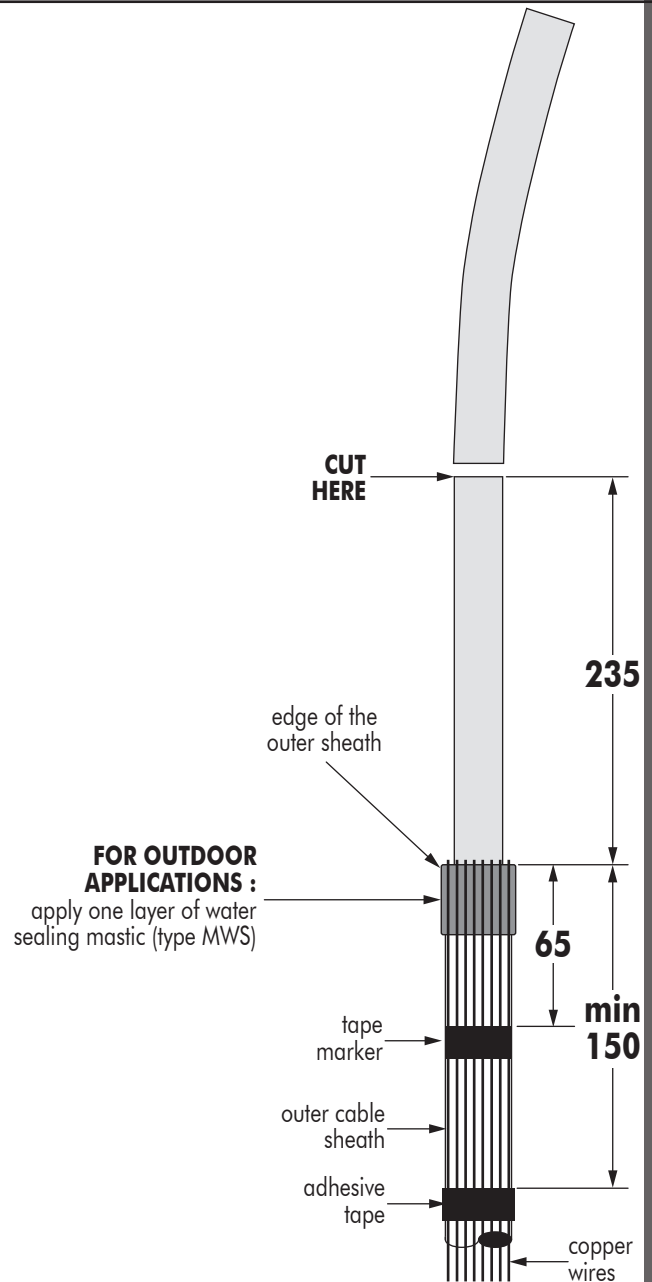

### For outdoor applications :

- Wrap one layer of water sealing mastic (type MWS) around the outer sheath, flush with the end (25 mm minimum width). Completely encircle the cable.
- Bend the screen wires back over the mastic and along the outer sheath, pressing them into the mastic.

**IMPORTANT :** screen wires should not touch each other when pressed into the mastic to prevent water ingress.


- 5 Using adhesive tape, fix the screen wires at a distance of min 150 mm from the edge of the outer sheath.
- 6 Cut the cable to a point 235 mm from the outer sheath.



FOR INFORMATION ONLY Please always use the instructions supplied in the kit




## For extruded easy strip semi-conductive screen

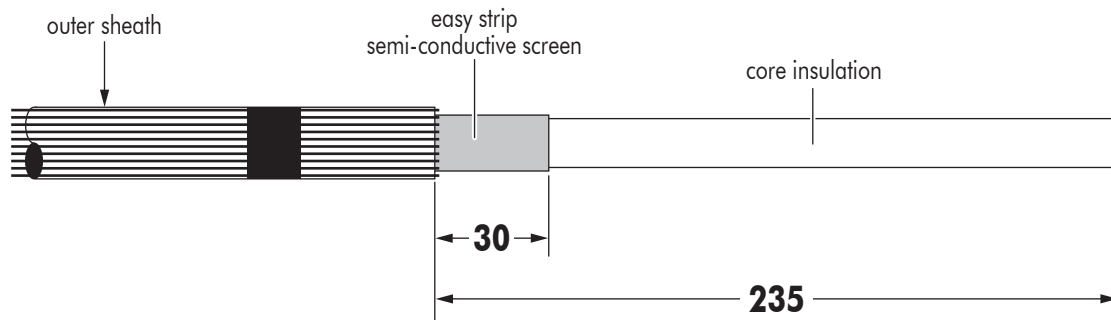

- 1 Check distance of **235** mm.
- 2 Remove the easy strip semi-conductive screen to a point **30** mm from the outer sheath. Cut squarely taking care not to cut the core insulation.


## For bonded extruded semi-conductive screen

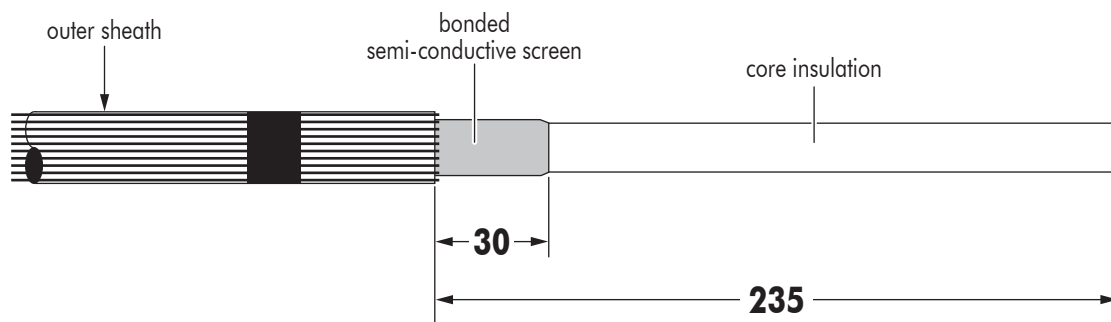


- 1 Check distance of **235** mm.
- 2 Remove the bonded semi-conductive screen to a point **30** mm from the outer sheath. Use an appropriate pencilling tool. Make a smooth transition between core insulation and semi-conductive screen.
- 3 **Remove any traces of conductive residue from the core insulation.**

## REMOVAL OF THE CORE INSULATION


### A. Compression type contacts (Type TBC-X)

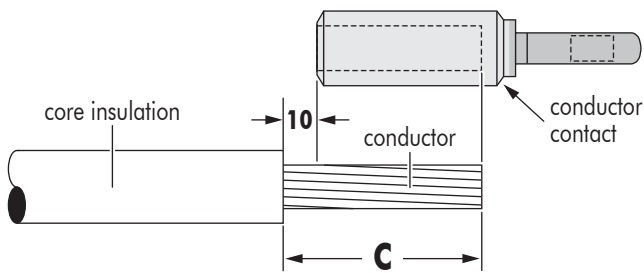

### B. Mechanical type contacts (Type TMBC-X)

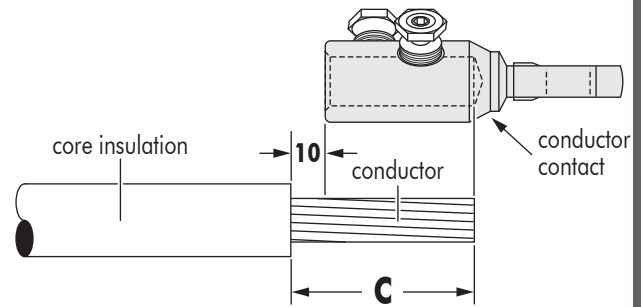


- 1 A. For compression type contacts :** remove the core insulation from the conductor for a distance « **C** » mm (**C** = depth of contact bore + **10** mm).
- 1 B. For mechanical type contacts :** remove the core insulation from the conductor for a distance « **C** » mm (**C** = depth of contact bore + **10** mm).

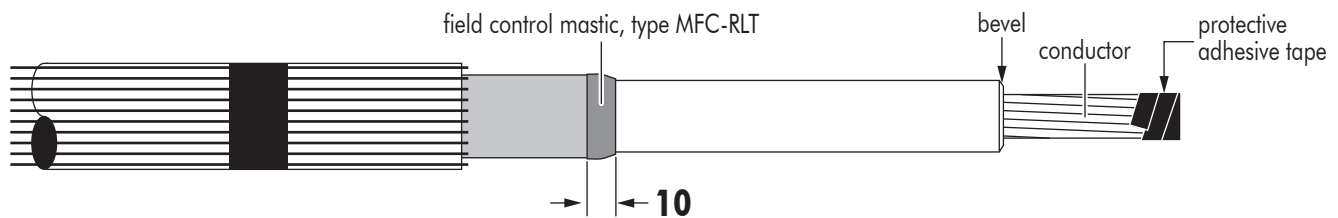

- 2** Slightly bevel the edge of the core insulation. **Do not sharpen in cone-shape.**
- 3 Thoroughly clean core insulation.** Always wipe towards the screen wires.
- 4** As a protection, wrap a few turns of adhesive tape around the conductor end.
- 5** Remove field control mastic strip, type MFC, from coated paper. Apply the mastic on the cutback edge of the semi-conductive screen, covering approximately **5** mm of the extruded semi-conductive screen and **5** mm of the core insulation. Push the mastic in place while stretching it progressively until both ends overlap and tear-off the excess mastic. Using the coated side of the paper, squeeze the mastic tightly in place on the step of the semi-conductive screen.

## INSTALLATION OF THE CABLE REDUCER

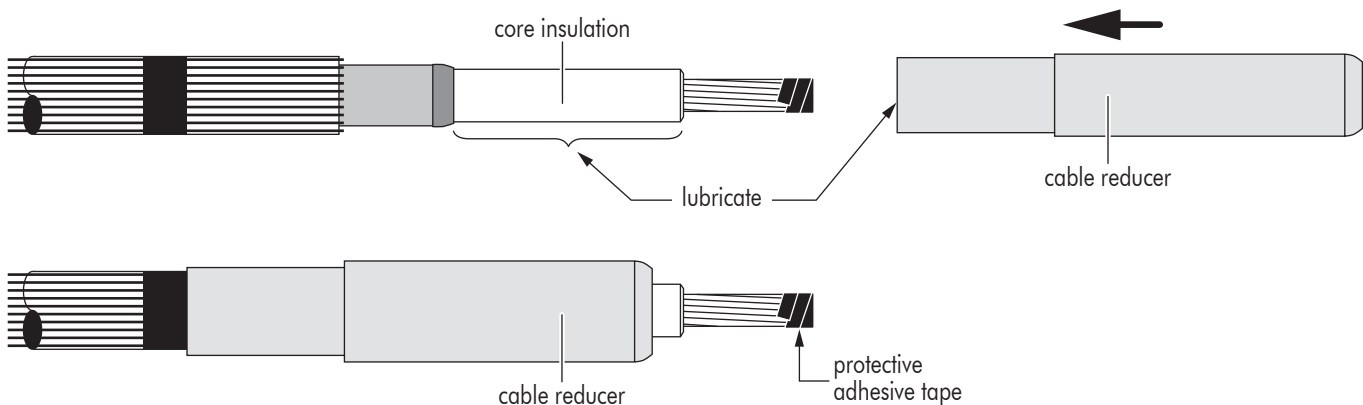


- 1** Lubricate\* the indicated area : core insulation and inner surface of the reducer.
- 2** Slide the reducer down the cable.
- 3** Remove the protective adhesive tape from the conductor.

\* USE ONLY THE SILICONE LUBRICANT SUPPLIED

## CRIMPING/TIGHTENING OF THE CONTACT

# A

### Compression type contacts (Type TBC-X)

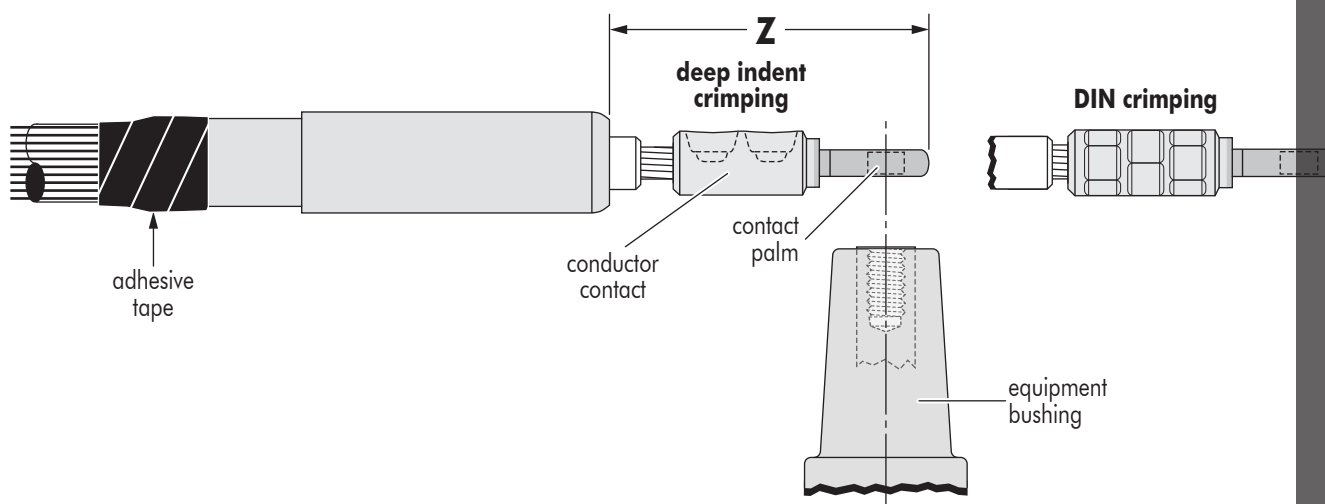

- 1 For aluminium conductors : before installing the conductor contact, wire brush the conductor.
- 2 Fit the contact on to the conductor.
- 3 Position the crimp contact taking care that the contact hole aligns with the bushing hole.
- 4 Prior to crimping, distance « **Z** » must be between **155** and **165** mm.
- 5 Crimp the contact. Please refer to the crimp chart for crimp sequence.
- 6 After crimping distance « **Z** » must be between **160** and **170** mm.  
If necessary, adjust the position of the cable reducer until distance « **Z** » is within the tolerance range.  
Using adhesive tape, secure the cable reducer.
- 7 **Remove any burrs left after crimping and wipe-off excess inhibitor.**




**FOR INFORMATION ONLY Please always use the instructions supplied in the kit**



**B**


## Mechanical type contacts (Type TMBC-X)

## Before tightening

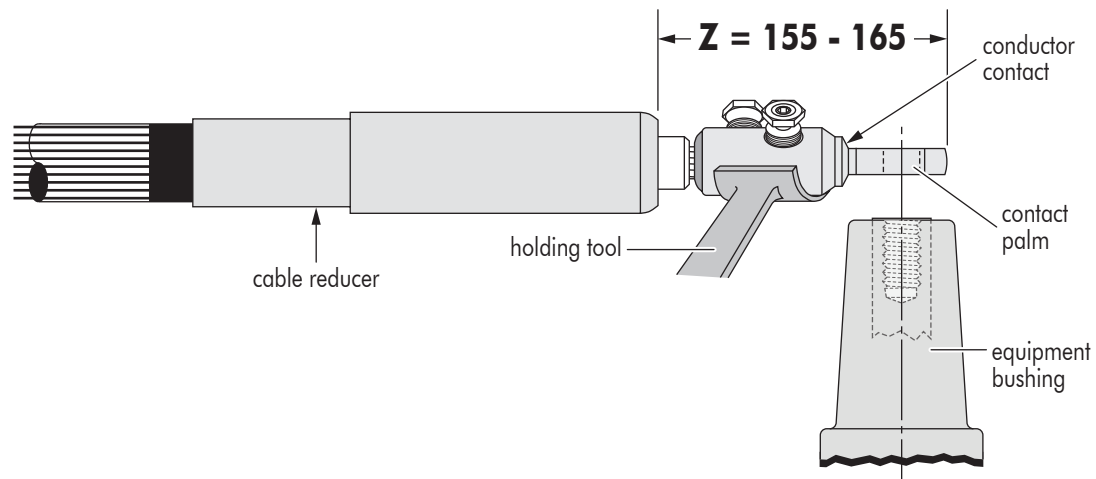

- 1 For aluminium conductors : before installing the conductor contact, wire brush the conductor.
- 2 Insert, if necessary, the centre ring into the contact barrel according to the table in the contact installation instruction.
- 3 Position the contact taking care that the contact hole aligns with the bushing hole.
- 4 Before tightening, distance « **Z** » must be between **155** and **165** mm.
- 5 Tighten the contact. Please refer to the installation instruction included with the contact.

## After tightening

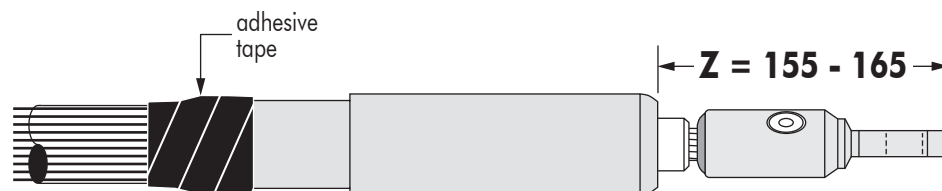


- 6 After tightening, distance « **Z** » must be between **155** and **165** mm.  
If necessary, adjust the position of the cable reducer until distance « **Z** » is within the tolerance range.  
Using adhesive tape, secure the cable reducer.



**FOR INFORMATION ONLY Please always use the instructions supplied in the kit**




## CONNECTOR INSTALLATION ON CABLE

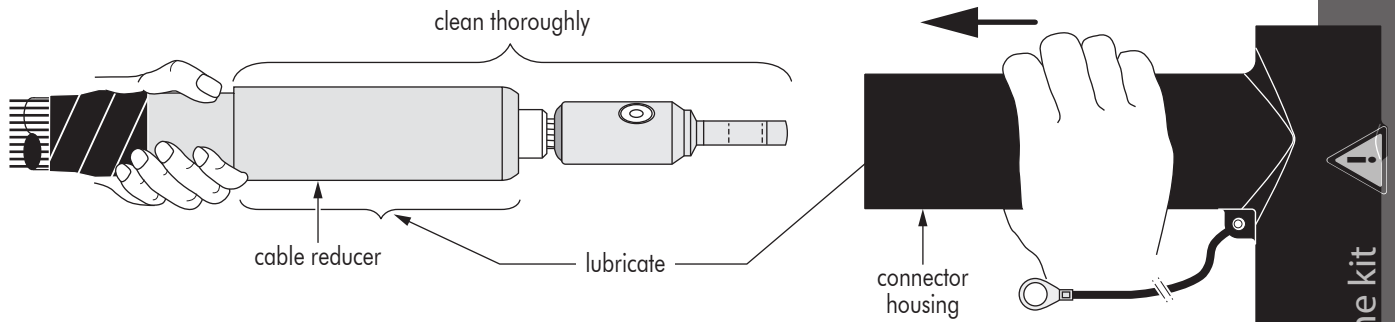

- 1 Clean cable reducer, core insulation and contact.**
- 2** Lubricate\* the inside of the connector housing and outer surface of the cable reducer.
- 3** Check if the **longer interface of the tee connector is pointed towards the bushing**. Whilst preventing the cable reducer from further movement down the cable, gently slide the housing on the cable. Its final position is reached when the centre of the contact spade is along the axis of the interfaces of the connector. **The cable reducer must stay in place during installation.**


## CONNECTOR INSTALLATION ON BUSHING

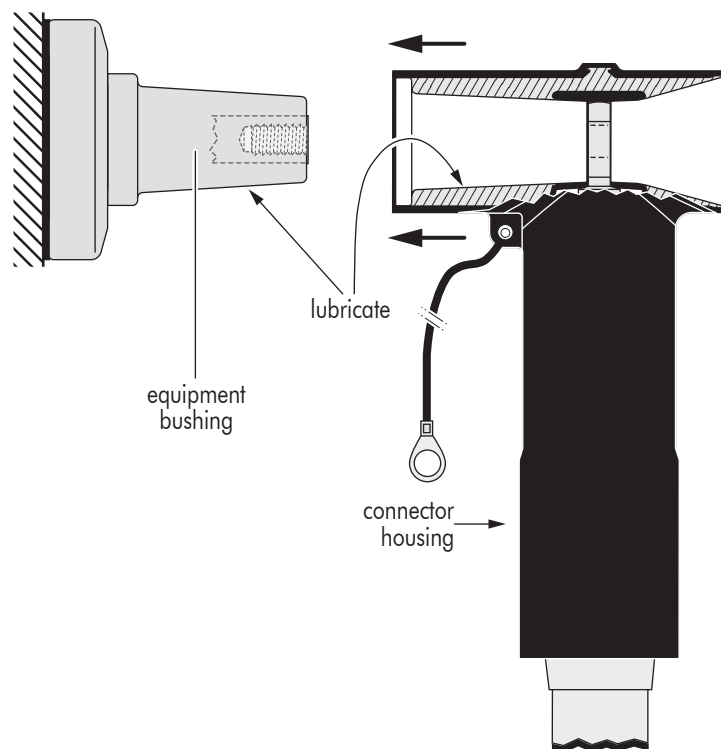

- 1** Clean and lightly lubricate\* both connector and bushing interface.
- 2** Push the connector on to the bushing.


FOR INFORMATION ONLY Please always use the instructions supplied in the kit



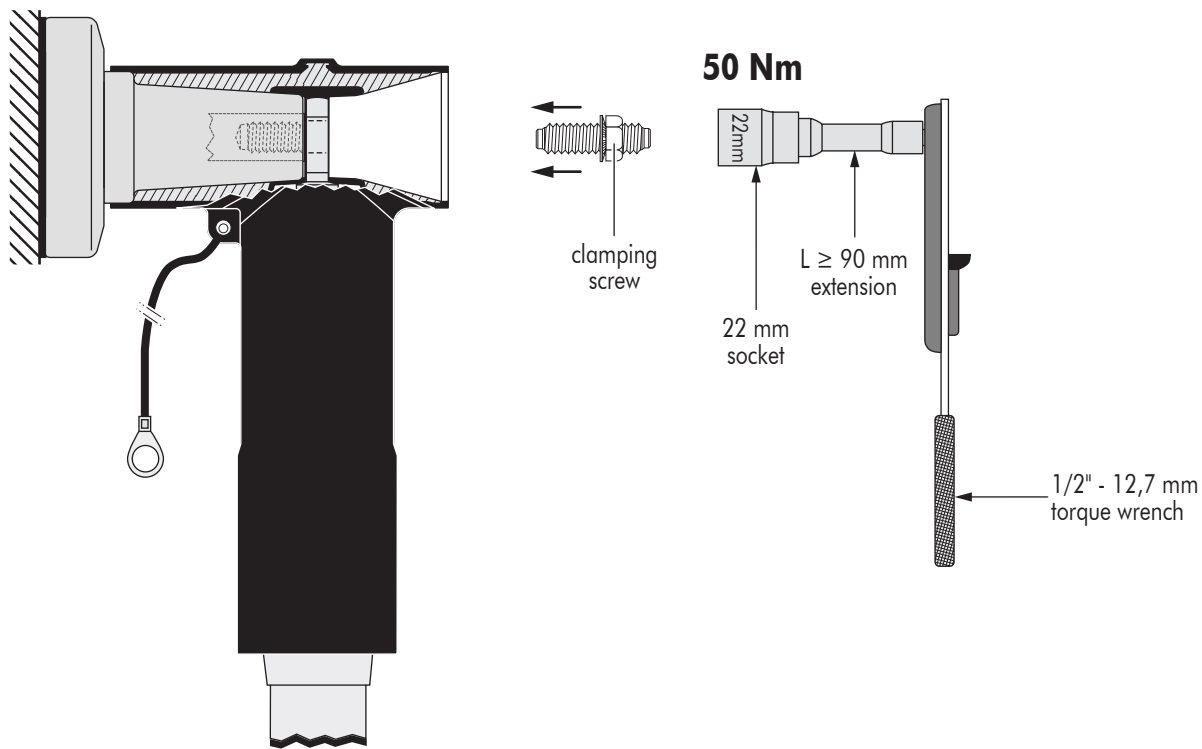

- 3 Insert clamping screw into the threaded hole of the bushing.
- 4 Use a torque wrench with a socket wrench 22 and tighten exerting **50 Nm** (5 kgm or 36,9 foot-pounds) of torque. **In order to achieve the correct applied torque ensure that there is no lubricant on the threaded parts.**

## INSTALLATION OF THE BASIC INSULATING PLUG

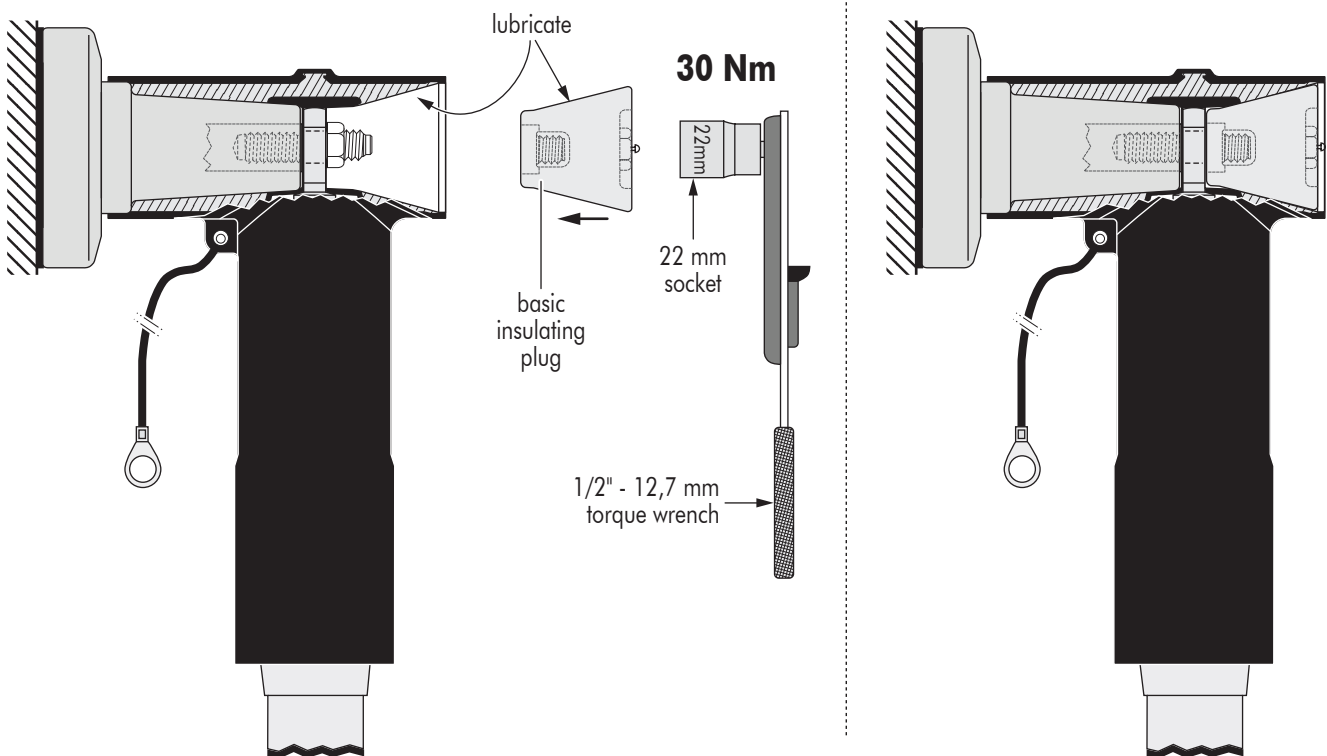

- 1 Clean and lubricate\* the insulating plug for the opposite side of the connector.
- 2 Insert the plug in the connector and tighten assembly : use torque wrench with socket of 22 and tighten exerting **30 Nm** (3 kgm or 22,1 foot-pounds) of torque. **In order to achieve the correct applied torque ensure that there is no lubricant on the threaded parts.**


\* USE ONLY THE SILICONE LUBRICANT SUPPLIED

FOR INFORMATION ONLY Please always use the instructions supplied in the kit





## INSTALLATION OF THE CAP

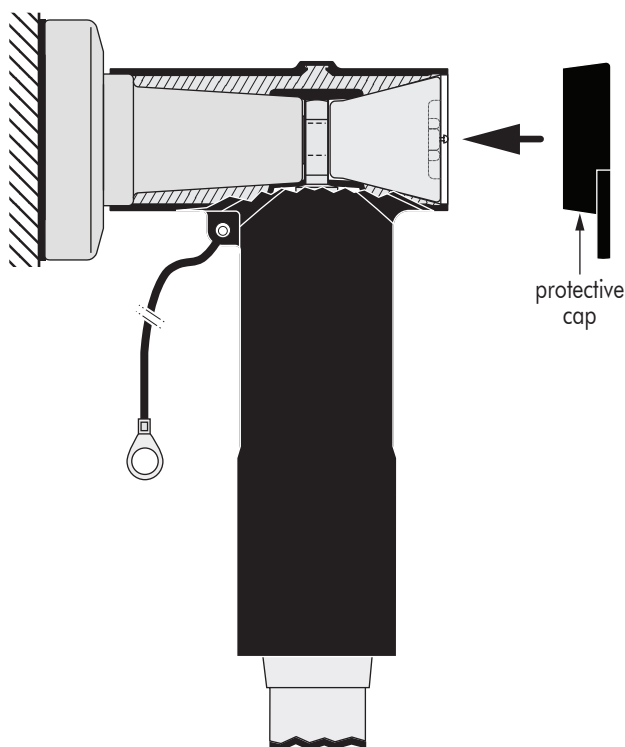

### Installation on insulating plug :

Clean the inside of the cap and the outside surface of the connector and insulating plug. Push the cap over the connector and on to the insulating plug. Slightly pull up the edge of the cap to exhaust the air during assembly. Press the centre of the cap on to the locking point until it snaps in place. Position the cap with the pulling tab pointing downwards.


### NOTE :

**A connector/bushing mated combination should not be allowed to carry the full weight of the cable. Therefore it is necessary to clamp the cable as close as possible to the connector.**

### IMPORTANT NOTES :

- **Never disconnect the connector from energised equipment nor energise a disconnected connector without previously installing on its appropriate corresponding mating part.**
- **Do not allow hydrocarbon oils or solvents to contaminate the E.P.D.M. rubber. In the event of contamination, wipe the surface clean with a dry cloth.**

## CONNECTOR EARTHING AND CABLE CLAMPING

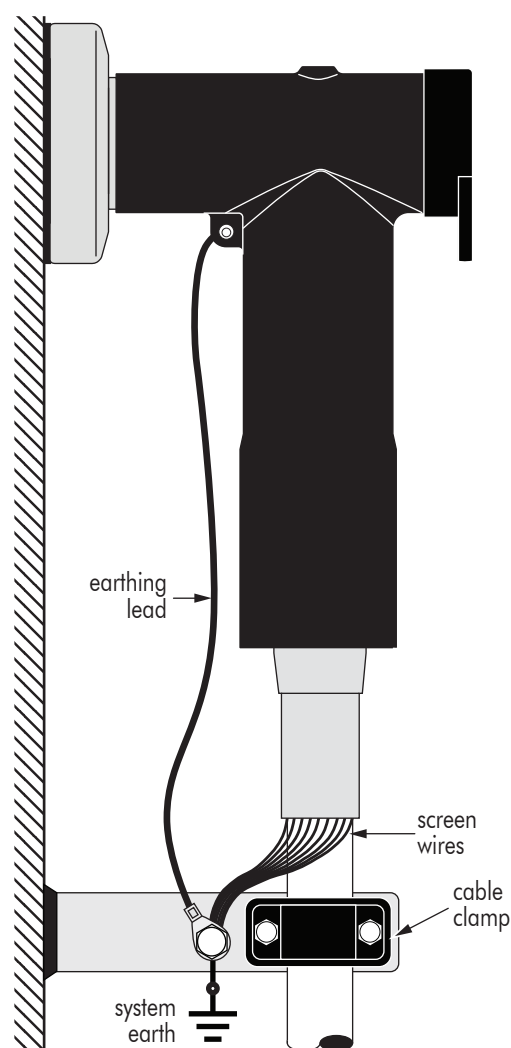

- 1** Bend back the screen wires along the outer sheath to form a pig tail.
- 2** Connect the earthing lead and screen wires to the system earth.



**FOR INFORMATION ONLY Please always use the instructions supplied in the kit**



**Euromold**  
a Nexans company

**Nexans Network Solutions NV - div. EUROMOLD**

Zuid III - Industrielaan 12  
B-9320 EREMBODEGEM-AALST – BELGIUM  
Tel: +32 (0)53/85 02 11 – Telefax: +32 (0)53/83 10 13  
sales.euromold@nexans.com